



441 Butler St. Springdale, PA 15144

412-461-8273 Fax: 412-461-0814

[www.hometeam.com/southpittsburgh](http://www.hometeam.com/southpittsburgh)

E-mail: [southpittsburgh@hometeam.com](mailto:southpittsburgh@hometeam.com)

# HomeTeam<sup>®</sup>

## INSPECTION SERVICE

**727 Newport Dr**  
**RE: Pittsburgh, PA 15234**  
**Inspection #: 527-052025-6270**

Dear Jennifer Cercone,

On 5/14/2025 HomeTeam Inspection Service made a visual inspection of the property referenced above. Enclosed please find a written, narrative report of our findings in accordance with the terms of our Home Inspection Agreement. Although maintenance items may have been addressed verbally at the time of the inspection, they may not be included in the enclosed report.

I trust the enclosed information is helpful and I hope you enjoy every aspect of your new home. If I can be of any assistance, please feel free to call me at the above telephone number.

Sincerely,

**HomeTeam Inspection Service**  
**Mike Pucci**

**PA Radon Firm Certification #2915**






# HomeTeam<sup>®</sup>

## INSPECTION SERVICE

---

### HOME INSPECTION REPORT

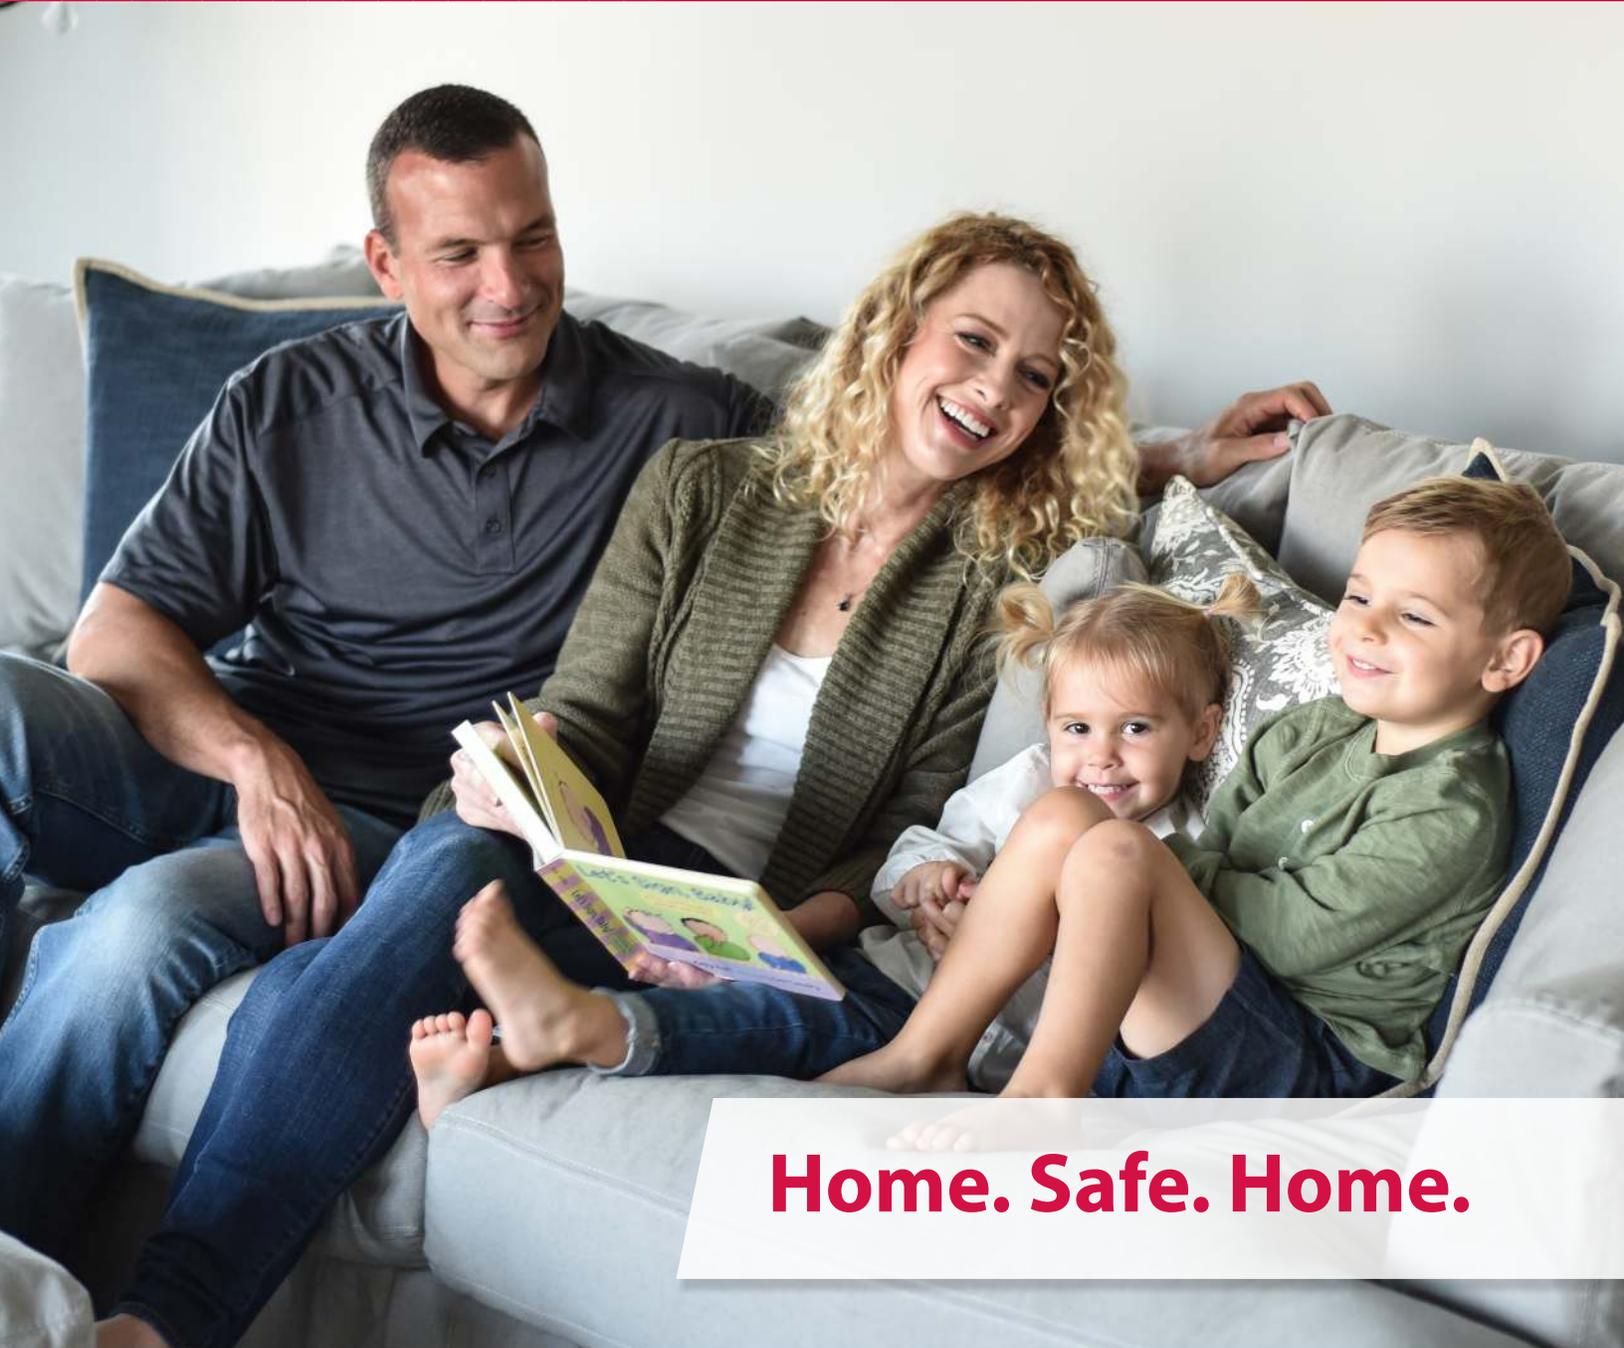

**Home. Safe. Home.**



## WHAT IS A HOME INSPECTION?

The purpose of a home inspection is to visually examine the readily accessible systems and components of the home. The inspectors are not required to move personal property, materials or any other objects that may impede access or limit visibility. Items that are unsafe or not functioning, in the opinion of the inspector, will be described in accordance with the standards of practice by which inspectors abide.

## WHAT DOES THIS REPORT MEAN TO YOU?

This inspection report is not intended as a guarantee, warranty or an insurance policy. Because your home is one of the largest investments you will ever make, use the information provided in this report and discuss the findings with your real estate agent and family to understand the current condition of the home.

## OUR INSPECTIONS EXCEED THE HIGHEST INDUSTRY STANDARDS.

Because we use a team of inspectors, each an expert in his or her field, our inspections are performed with greater efficiency and more expertise and therefore exceed the highest industry standards. We are pleased to provide this detailed report as a service to you, our client.

## WE BELIEVE IN YOUR DREAM OF HOME OWNERSHIP.

We want to help you get into your dream home. Therefore, we take great pride in assisting you with this decision making process. This is certainly a major achievement in your life. We are happy to be part of this important occasion and we appreciate the opportunity to help you realize your dream.

## WE EXCEED YOUR EXPECTATIONS.

Buying your new home is a major decision. Much hinges on the current condition of the home you have chosen. That is why we have developed the HomeTeam Inspection Report. Backed by HomeTeam's experience with hundreds of thousands of home inspections over the years, the report in your hand has been uniquely designed to meet and exceed the expectations of today's homebuyers. We are proud to deliver this high-quality document for your peace of mind. If you have any questions while reviewing this report, please contact us immediately.

**Thank you for allowing us the opportunity to serve you.**



FAST



TRUSTED



ACCURATE

**PREFACE:**

This report is intended for the sole, confidential, and exclusive use and benefit of the Client(s) under a written HomeTeam Inspection Agreement. This report is not intended for the benefit of, and may not be relied upon by, any other party. The disclosure or distribution of this report to the current owner(s) of the property inspected or to any real estate agent will not make those persons intended beneficiaries of this report. HomeTeam Inspection Service has no liability to any party (other than the HomeTeam client named above, for whom this report was expressly prepared) for any loss, damage or expense (including, without limitation, attorney fees) arising from any claim relating to this report.

A home inspection is intended to assist in evaluation of the overall condition of the dwelling. The inspection is based on observation of the visible and apparent condition of the structure and its components on the date of the inspection. We will not render an opinion as to the condition of any systems or components of the structure that are concealed by walls, floors, drywall, paneling, suspended ceiling tiles, insulation, carpeting, furniture or any other items stored in or on the property at the time of the inspection.

The results of this home inspection are not intended to make any representation regarding the presence or absence of latent or concealed defects that are not reasonably ascertainable in a competently performed home inspection. No warranty or guaranty is expressed or implied.

If the person conducting your home inspection is not a licensed structural engineer or other professional whose license authorizes the rendering of an opinion as to the structural integrity of a building or its other component parts, you may be advised to seek professional opinion as to any defects or concerns mentioned in the report. If the age, condition or operation of any system, structure or component of the property is of a concern to you, it is recommended that a specialist in the respective field be consulted for a more technically exhaustive evaluation.

This home inspection report is not to be construed as an appraisal and may not be used as such for any purpose.

This inspection report includes a description of any material defects (\*) noted during the inspection, along with any recommendation that certain experts be retained to determine the extent of the defects and any corrective action that should be taken. Any material defect that poses an unreasonable risk to people on the property will be conspicuously defined as such. Any recommendations made to consult with other specialists for further evaluation as a result of our findings should be complete prior to the conclusion of the inspection contingency period. The Client warrants they will read the entire Inspection Report when received and shall promptly contact HomeTeam regarding any questions or concerns the Client may have regarding the inspection or the Inspection Report.

The majority of home inspections are performed on pre-existing structures. The age of these structures vary from just a few years to over 99 years old. Building techniques have changed dramatically over the years. These changes are what bring character to the neighborhoods of Western Pennsylvania, and affect a buyer's decision to purchase one home over another. Therefore, the age and method of construction will affect the individual character of a home.

We will not determine the cause of any condition or deficiency, determine future conditions that may occur including the failure of systems and components or consequential damage or components or determine the operating costs of systems or components.

It is not uncommon to observe cracks or for cracks to occur in concrete slabs or exterior and interior walls. Cracks may be caused by curing of building materials, temperature variations and soil movement such as: settlement, uneven moisture content in the soil, shock waves, vibrations, etc. While cracks may not necessarily affect the structural integrity of a building, cracks should be monitored so that appropriate maintenance can be performed if movement continues at an abnormal rate. Proper foundation maintenance is key to the prevention of initial cracks or cracks enlarging. This includes, but not limited to proper watering, foundation drainage and removal of vegetation growth near the foundation.

\* Material Defect: A problem with a residential real property or any portion of it that would have a significant adverse impact on the value of the property or that involves an unreasonable risk to the people on the property. The fact that a structural element, system or subsystem is near, at or beyond the end of the normal useful life of such a structural element, system or subsystem is not by itself a material defect.

SUMMARY: The purpose of this summary is to provide a "quick view" of the results of the home inspection. Please be sure to read the full body of the inspection report, as it contains much more detail about your new home. Any recommendations for additional evaluation must be performed prior to the conclusion of the inspection contingency period. You should ask the seller to provide receipts or other suitable documentation as evidence that items requested as part of the reply to home inspection were complete by qualified individuals.

The following notable items were observed during the inspection performed at 727 Newport Dr, Pittsburgh, PA 15234:

**PLEASE NOTE each summary bullet point is a link.** Simple click on the bullet point to drop down into that section of the report.

### **Safety Concerns**

- A loose outlet was noted in the in the bathroom.
- There were several trip hazards found on the driveway.
- There were several trip hazards found on the walkways around the house.
- The risers or backs of the deck stairs are open. This could be a fall hazard for small children.

### **General Description**

- Rotted wood was noted around the windows .
- Many deck boards were deteriorated at the time of the inspection.

### **Roof Structure**

- Loose fascia was noted on the right side.
- Damaged downspout extension were noted on the right front.
- Several shingles were out of position on the front of the roof at the time of the inspection.
- An adequate roof repair was noted on the front.
- Loose flashing was noted on the front porch roof.
- The rain hat on top of the chimney is missing.
- There were cracks on the top cap(s)of the chimney.

### **Garage**

- A substance with the characteristics of mold is visible in one or more areas of the garage.
- There were signs of moisture on the rear garage wall.

### **Plumbing**

- Minor plumbing issues were noted during the inspection.
- There is no expansion tank installed on the water heater.
- An open plumbing vent pipe was noted in the bathroom.
- A leaky plumbing fitting was noted on a cold water supply line above the water heater.

### **Electric Service**

- The weatherhead at the top of the electric service entrance cable is not attached.
- Two prong outlets were found in one or more locations in the home.
- One or more missing switch or outlet covers were noted in the basement.

### **Basement**

- There were signs of moisture on the front and left basement walls.
- A substance with the characteristics of mold is visible in one or more areas of the basement.
- The basement ceiling is water marked below the living area from what appears to be a previous leak.

### **Windows, Doors, Walls and Ceilings:**

- Cracked or bubbling paint was noted on the ceiling in the kitchen.

- The walls in the tub / shower area show evidence of water damage.
- One or more of the insulated window panes throughout the home had a defective thermal seal.

**First Level**

- The microwave door handle is missing.

**Attic Structure**

- The roof deck as viewed from the attic is water marked.

## GENERAL DESCRIPTION

Throughout this report, the terms "right" and "left" are used to describe the home as viewed from the street. A system or component has a material defect if it has a significant impact on the value or safety of the property. The HomeTeam inspects for evidence of structural failure and safety concerns only. The cosmetic condition of the paint, wall covering, carpeting, window coverings, etc., are not addressed. All conditions are reported as they existed at the time of the inspection. Routine maintenance and safety items are not within the scope of this inspection unless they otherwise constitute material visually observable defects. Although some maintenance and/or safety items may be disclosed, this report does not include all maintenance or safety items, and should not be relied upon for such items.

### *NOTE: WATER MARKED BASEMENT CEILING:*

The basement ceiling is water marked below the living area from what appears to be a previous leak. The area was dry at the time of the inspection. No immediate action is required. The area should be monitored for evidence of new leaks. Consult with a qualified contractor for repair if required.



The inspected property consisted of a two story wood-framed structure with brick veneer that was occupied at the time of the inspection. There were no material defects on the visible portions of the siding.

### *MAINTENANCE NOTE: LINTELS:*

One or more of the steel lintels above the windows on the exterior of the home were noted to be rusting. Lintels support masonry materials above doors and windows. Keeping the lintels sealed and painted will prevent rusting and expansion. Expanded lintels can lead to cracks in the masonry on the exterior of the home.



### *NOTE: EXTERIOR WOOD ROT:*

Rotted wood was noted around the windows. The areas should be repaired and sealed by a qualified contractor.



Dining room

**MAINTENANCE NOTE: PEELING PAINT:**

Peeling paint was noted on many areas of the exterior. In order to preserve the life of the exterior surfaces and materials, all areas should be scraped and painted.



**MAINTENANCE NOTE: EXTERIOR CAULKING:**

The exterior caulking around the doors is cracked or missing on the back of the home. The caulking should be replaced to ensure the exterior of the home remains weather and water tight.



*NOTE: EXTERIOR WOOD ROT:*

Rotted wood was noted on the wood soffit . The areas should be repaired and sealed by a qualified contractor.



The approximate temperature at the time of the inspection was 65 to 70 degrees Fahrenheit, and the weather was cloudy. The buyers representative was present at the time of the inspection. All of the utilities were on at the time of the inspection.

## **LOT AND GRADE**

The home was situated on a moderately sloped lot. The general grade around the home appeared to be questionable on the front to direct rain water away from the foundation. The age of the home, as reported by the MLS sheet was said to be seventy to eighty years old. The inspection does not include any geological surveys, soil compaction surveys, ground testing, or evaluation of the effects of, or potential for earth movement such as earthquakes, landslides, sinking, rising or shifting for any reason. Information on local soil conditions and issues should be obtained from local officials and/or a qualified specialist. Additionally, the inspection does not include evaluation of elements such as underground drainage systems, site lighting, irrigation systems, barbecues, sheds, detached structures, fencing, privacy walls, pools, spas and other recreational items.

## **WALKWAY AND PORCHES**


There was a cement pavers walkway leading to a concrete porch in the front of the home. Surface defects in walkways develop and progress with age and are considered normal as long as they do not create a safety hazard. There were no material defects observed in the walkway or the porch.

*SAFETY NOTE: TRIP HAZARDS:*

There were several trip hazards found on the walkways around the house. The hazards can be repaired using a suitable or similar surfacing material to "feather" the out-of-level condition to make a smooth transition.



There was a flagstone patio located in the back of the home. There were no material defects observed to the patio.

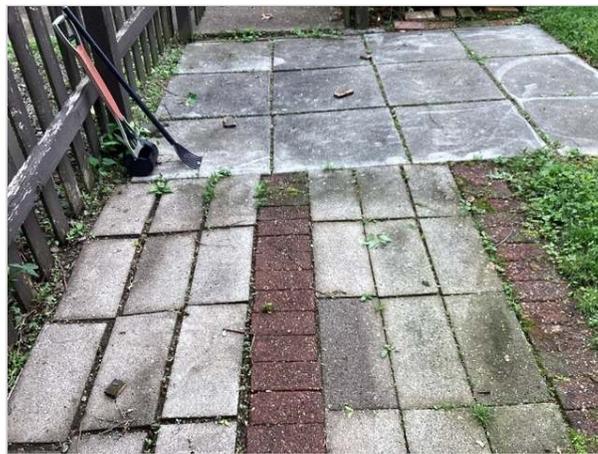

## **DECK**

There was a wood deck located in the back of the home. The deck appeared to be properly anchored to the main structure of the home. The vertical supports on the deck appear to be adequate to support the outer load of the deck. Construction methods, attachment requirements and supporting load specifications have changed dramatically over the years. The deck inspection provides a general condition report and is not meant to imply that the construction meets current standards. Consult with the local municipality for current deck construction requirements. There appeared to be significant deterioration of the deck surface. The handrails on the deck were secured. A wood deck should be cleaned and sealed regularly to prevent deterioration. There were no material defects observed on the visible portions of the deck or support structure.

### ***SAFETY NOTE: OPEN BACK STAIR RISERS:***

The risers or backs of the deck stairs are open. This could be a fall hazard for small children. Consult with a qualified contractor for evaluation and recommendations.



**NOTE: DETERIORATED DECKING:**

Many deck boards were deteriorated at the time of the inspection. Consult with a qualified contractor for replacement estimates.



**DRIVEWAY**

There was a concrete driveway on the right side of the home which led to the integral garage. There were notable deterioration and trip hazards noted on the driveway. Surface defects in driveways develop and progress with age and are considered normal as long as they do not create a safety hazard. There were no material defects observed in the driveway.



**SAFETY NOTE: TRIP HAZARDS:**

There were several trip hazards found on the driveway. The hazards can be repaired using a suitable or similar surfacing material to "feather" the out-of-level condition to make a smooth transition.



**ROOF STRUCTURE**

The roof was a gable design covered with asphalt/fiberglass shingles. Observation of the roof surfaces, flashing, skylights and penetrations through the roof was performed by drone. We will access the roof as long as it is dry, has a pitch that can be safely walked and accessible with the 16 foot ladder we carry. The age of the roof covering, as reported by the MLS sheet, was unknown. There was one layer of shingles on the roof at the time of the inspection. There was moderate curling and moderate surface wear observed on the roof shingles at the time of the inspection. These conditions indicate the roof shingles were in the late second half of their useful life.



**NOTE: SOFFIT & FASCIA:**

Loose fascia was noted on the right side. Consult with a qualified contractor for repair.



**NOTE: ROOF SHINGLES:**

Several shingles were out of position on the front of the roof at the time of the inspection. While this condition is not necessarily an indication of a leak, repairs should be made. Consult with a qualified roofer for repair.



**NOTE: ROOF REPAIR:**

An adequate roof repair was noted on the front. The repair appeared to be made correctly. There was no evidence of an active roof leak noted at the time of inspection. It is recommended that a qualified roofing contractor be consulted for further evaluation and recommendations.



**NOTE: LOOSE FLASHING:**

Loose flashing was noted on the front porch roof. Loose flashing could be a leak source. We cannot always determine if active leaks exist. Consult with a qualified roofer for further evaluation and repair.



The aluminum soffit and fascia was inspected and was in fair condition.

This visual roof inspection is not intended as a warranty or an estimate on the remaining life of the roof. Any roof metal, especially the flashing and valleys, must be kept well painted with a paint specially formulated for the use. All roof penetrations require maintenance and can crack, loosen or leak during or after significant weather events such as wind or rain. These areas should be monitored for changes in characteristic and repaired as required by a qualified roofer. There were no material defects detected on the exterior of the roof.

## RUBBER ROOF

The front porch roof was covered with EPDM rubber roofing. The roof was inspected by walking on the roof. The roofing was in fair condition. There was no shrinkage noted. The termination strips, if installed were intact. The visible seams were intact. The roof appeared to be in the second half of its useful life. There were no material defects noted on the roof.

### INFORMATIONAL NOTE: RUBBER ROOF:


Rubber roofs have many seams and patchwork that are glued, welded or mechanically fastened together. Seams, roof penetrations, patches and terminations require installation procedures specified by the manufacturer that are beyond the knowledge and scope of a general home inspection. The joints often de-laminate after exposure to the elements and changes in weather. We were not able to walk the roof during the inspection to inspect every seam. We strongly suggest that you contact a qualified rubber roofer to perform a complete inspection of the rubber roof.



The roof drainage system consisted of aluminum gutters and downspouts which appeared to be functional at the time of the inspection. Gutters and downspouts should receive routine maintenance to prevent premature failure. There were no material defects observed on the visible portions of the gutters or downspouts.

### NOTE: DAMAGED GUTTERS AND/OR DOWNSPOUTS:

Damaged downspout extension were noted on the right front. Gutters and downspouts help facilitate proper drainage of roof water away from the foundation of the home. Consult with a qualified, reputable contractor to install proper roof drainage.

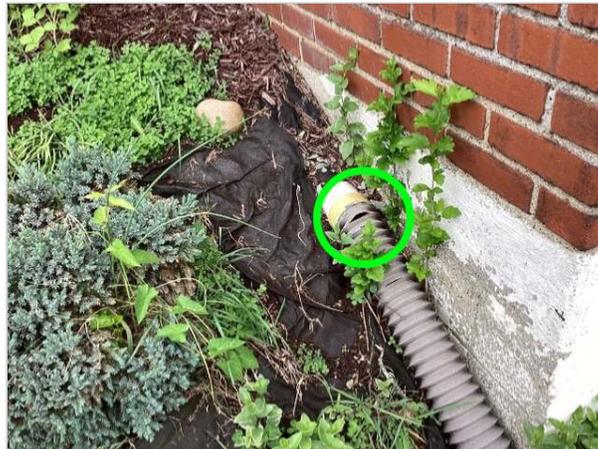

There was one chimney. Observation of the chimney exterior was made from with a drone. A rain hat was not installed on the chimney. Rain hats are not required but can help prevent excessive water running down the chimney as well as keeping animals out. Flue chases should always have some type of rain hat. In this case rain hats are not applicable since there are no flue chases. There were no material defects observed on the exterior.

*NOTE: RAIN HAT:*

The rain hat on top of the chimney is missing. Repairs should be made by a qualified roofer.

*NOTE: CHIMNEY BRICKWORK:*

There were cracks on the top cap(s)of the chimney and repairs should be made to prevent further deterioration. Consult with a qualified masonry contractor for repair.



## **GARAGE WITH OPENER**

The integral garage was designed for one car with access provided by one overhead-style door. Safety cables were not installed inside the door springs. The Lift Master brand electric garage door opener was tested and found to be functional. The automatic safety reverse on the garage door was tested and found to be functional. The functionality of remote transmitters, keyless entry or other opening devices is not tested during the home inspection. The fire separation walls and ceiling were inspected and did appear to be adequate. The concrete garage floor was in fair condition. There were no material defects observed in the garage or the door mechanisms.


*NOTE: GARAGE MOISTURE EVIDENCE:*

There were signs of moisture on the rear garage wall. The area was dry at the time of the inspection. Dampness on garage walls is not always a sign of water intrusion. The dampness can be the result of warm humid air making contact with cool walls. In many cases the humid air condenses on the wall and forms a layer of moisture. It is important to assess whether moisture on the walls is the result of water intrusion or condensation. In this case the condition appears to be the result of water intrusion. The exterior grading in the affected area is questionable. Many water intrusion problems can be controlled by improving the drainage on the exterior of the home. It is important that all roof drainage

and surface water is directed away from the foundation. Any concern about this condition should be referred to a qualified contractor for evaluation and recommendations.



A substance with the characteristics of mold is visible in one or more areas of the garage. The EPA (<http://www.epa.gov/mold/moldresources.html>) advises consumers that areas less than ten square feet of coverage can usually be controlled using readily available household products. In the event the substance cannot be controlled, a certified mold testing and remediation firm should be contacted for a recommended course of action.

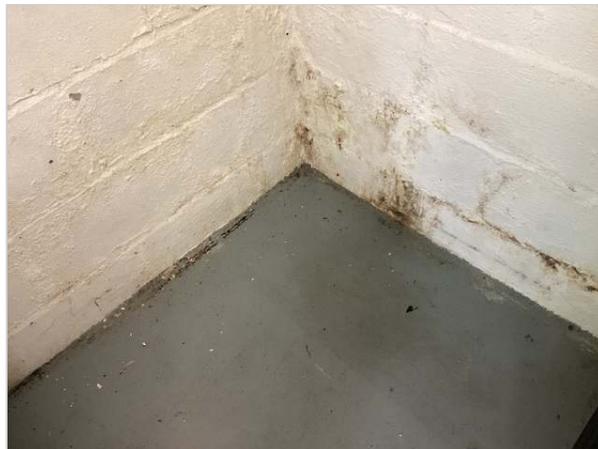

**GENERAL STATEMENT ON MOLD :** The presence of certain mold and mold spores in housing can result in mild to severe health effects in humans and can deteriorate the structure of the dwelling resulting in structural damage. Health effects include, but are not limited to: asthma, allergy symptoms, watery eyes, sneezing, wheezing, difficulty breathing, sinus congestion, blurry vision, sore throat, dry cough, aches and pains, skin irritation, bleeding of the lungs, headaches, memory loss and fever. As humans vary greatly in their chemical make-up, so does the individual's reaction to mold exposure. For some people, a small number of mold spores can cause ill effects. In others it may take many more.

**RECOMMENDATION:**

The installation of safety cables in the garage door springs will prevent a breaking spring from flying and possibly damaging objects in its path. The cables are inexpensive and easy to install and can be purchased at any home improvement store.



## **FOUNDATION**

The foundation was constructed of concrete block. A single inspection cannot determine whether movement of a foundation has ceased. Any cracks should be monitored regularly. There were no material defects observed on the visible portions of the foundation.

There were several minor, settlement cracks observed on the foundation. The cracks were 1/16-inch or less in width. These cracks are common and usually insignificant. All buildings experience some settlement. Settlement cracks most often occur within the first few years after construction as the soil under the structure accommodates itself to the load of the structure. However, the significance of cracks cannot always be judged by a single inspection. All cracks should be monitored for significant changes in characteristics. Consult with a company specializing in foundation repair if there is a marked change in the size or dimension of a crack.

## **BASEMENT**

The full basement was partially finished, and contained the following mechanical systems: furnace and water heater. The concrete basement floor was in satisfactory condition. Minor cracks within any concrete slab are common and are most often due to shrinkage and settlement. Concrete floors are poured after the structure is built and serve no purpose with regard to structural support.

The basement stairway was inspected and there were no material defects observed with the steps, stairways or handrails.

The finished basement area included partially finished game room and half bath with laundry included.

### *INFORMATIONAL NOTE: BASEMENT WALLS:*

The interior walls of the basement were finished; therefore, a complete inspection of the concrete block foundation was not possible. There were not material defects observed on the visible portions of the foundation.

The basement was dry at the time of the inspection. Because the basement is below grade, there exists a vulnerability to moisture penetration after heavy rains.

There was no evidence of an interior french drain system in the home. French drains are not required, but are often installed to control or prevent water intrusion. Some french drains discharge into a sump, while others do not. If a sump is present, there is a separate section of this report with details on the sump and pump, if present. Most french drain systems are concealed below the floor. As a result, it is typically not possible for us to determine the type of installation, the coverage of the system or if the system is operable. Consult with the current property owner for more information.

There were no material defects observed in the basement.

### *NOTE: BASEMENT MOISTURE EVIDENCE:*

There were signs of moisture on the front and left basement walls. The area was dry at the time of the inspection. Dampness on basement walls is not always a sign of water intrusion. The dampness can be the result of warm humid air making contact with cool walls. In many cases the humid air condenses on the wall and forms a layer of moisture. It

is important to assess whether moisture on the basement walls is the result of water intrusion or condensation. In this case the condition appears to be the result of water intrusion. The exterior grading in the affected area is questionable. Many water intrusion problems can be controlled by improving the drainage on the exterior of the home. It is important that all roof drainage and surface water is directed away from the foundation. Any concern about this condition should be referred to a qualified contractor for evaluation and recommendations.



Front left



Left rear



Behind furnace

A substance with the characteristics of mold is visible in one or more areas of the basement, note that when possible mold like substance was found behind the drywall. . The EPA (<http://www.epa.gov/mold/moldresources.html>) advises consumers that areas less than ten square feet of coverage can usually be controlled using readily available household products. In the event the substance cannot be controlled, a certified mold testing and remediation firm should be contacted for a recommended course of action.



Behind drywall in electric panel area



Behind furnace

GENERAL STATEMENT ON MOLD : The presence of certain mold and mold spores in housing can result in mild to severe health effects in humans and can deteriorate the structure of the dwelling resulting in structural damage. Health effects include, but are not limited to: asthma, allergy symptoms, watery eyes, sneezing, wheezing, difficulty breathing, sinus congestion, blurry vision, sore throat, dry cough, aches and pains, skin irritation, bleeding of the lungs, headaches, memory loss and fever. As humans vary greatly in their chemical make-up, so does the individual's reaction to mold exposure. For some people, a small number of mold spores can cause ill effects. In others it may take many more.

Please note that it is not within the scope of this inspection to determine or predict the amount or frequency of past or future water intrusion into the basement. HomeTeam will make its best effort in accordance with the ASHI Standards of Practice to determine, based solely on visible conditions at the time of the inspection, whether there is any evidence of ongoing water penetration in the property. You should use all available resources including the seller disclosure and information from the current owner to determine if any water issues exist. Consult with a company specializing in water proofing if you require a guarantee of a 100 percent dry basement.

## **FLOOR-STRUCTURE**

The visible floor structure consisted of a wood planking subfloor, supported by two-inch by ten -inch wood joists spaced sixteen inches on center. There were no material defects observed in the visible portions of the floor structure.

### *INFORMATIONAL NOTE: BASEMENT CEILING:*

Most of the basement ceiling was finished, which restricts a clear view of the floor joists. As a result, we were not able to see the entire floor structure during the inspection. Determining the presence of concealed defects is beyond the scope of the inspection.

## **WATER-METER**

The water meter was located in the basement. The main water shutoff valve for the home was located adjacent to the water service entry point in the basement. Water shutoff valves are visually inspected only. No attempt is made to operate the main or any other water supply shutoff valves during the inspection. These valves are infrequently used and could leak after being operated. The only exception to this policy is made when the main water supply valve is off upon arrival at the inspection. Since it is the buyers right to have all utilities operable for the home inspection, we will attempt to turn the main water valve on for the inspection. The HomeTeam is not responsible for leaks caused by operating the valve.



## **PLUMBING**

The visible water supply lines throughout the home were copper and PEX pipe. The water was supplied by a public water supply. Water valves are not tested as part of the home inspection. Water valves that have not been operated for an extended period of time often leak after being operated. We would not be able to repair a leaking valve during the home inspection. The visible waste lines consisted of cast iron and PVC pipe. The functional drainage of the drain waste lines appeared to be adequate at the time of the inspection. The home was connected to a public sewer system. The under-floor drain lines are considered underground utilities and are specifically excluded from the inspection. The lines are not visible or accessible and their condition cannot be verified during a visual home inspection. Simply running water into plumbing fixtures or floor drains will not verify the condition of the waste line infrastructure under the home.

Consult with a qualified plumber for a video camera inspection of the sewer laterals if there is any concern as to the condition of the waste lines under the home. A video scan is the only way to confirm the condition of the drain system. Our inspection of the plumbing system is a functional inspection only. We make no attempt to validate that the plumbing system complies with any codes. Additionally, we cannot validate the workmanship of the plumbing system to be up to standard. We are generalists and do not claim to know everything about any trade. Any concern about the quality or adequacy of the plumbing system should be referred to a qualified, reputable plumber. All plumbing fixtures not permanently attached to a household appliance were operated and inspected for visible leaks. Water flow throughout the home was not tested.. There were no material defects observed in the visible portions of the plumbing system.


*NOTE: MINOR PLUMBING ISSUES:*

Minor plumbing issues were noted during the inspection. This is not intended to be an all inclusive list. Concealed, latent or intermittent plumbing issues may not be apparent during the testing period. Consult with a qualified plumber for further evaluation and repairs as required.

- 
- Second floor full bath shower faucet is loose in the wall.
- Second floor full bath tub stop and waste valve is inoperable.

*NOTE: OPEN PLUMBING VENT:*

An open plumbing vent pipe was noted in the bathroom. The area should be properly covered to prevent debris falling into the plumbing. Consult with a qualified plumber for repair.

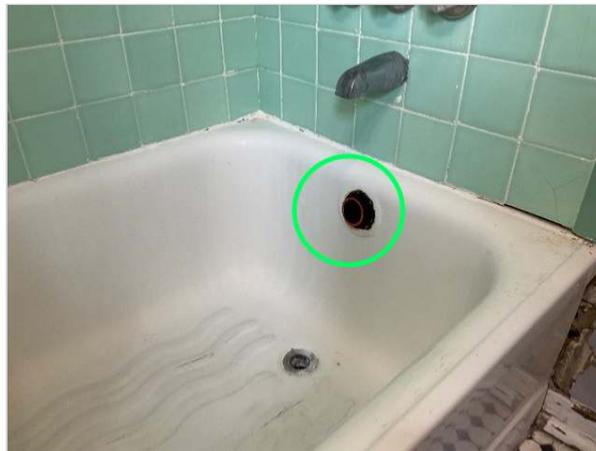

## **GAS METER**

The gas meter was located in the basement. The gas supplier for the home based on the identification tag on the meter is Columbia. The main gas valve is usually located at the gas meter and requires a wrench to operate. All visible and readily accessible valves and fittings are tested for leaks using an electronic gas leak detector. No leaks were detected. There was no noticeable odor of gas detected at the time of the inspection. The exterior gas line is below grade, classified as underground utilities and cannot be inspected. HomeTeam recommends enrolling in the gas company's line protection program. The program is available for a low monthly fee, and will cover the majority, if not all of the replacement cost of the main exterior gas line in the event it fails.

*INFORMATIONAL NOTE: GAS APPLIANCES THAT ARE OFF:*

In the interest of the safety of the inspector and everyone involved, we will not make any attempt to light pilots that are extinguished. It is possible that the gas used to keep a flame lit will continue to flow. If this continues, its concentration may reach a point where a spark or flame will cause a flare up or flashback. We suggest that if it is noted in this report that a gas appliance was not tested because the pilot or gas was off, that you consult with the property owner to have the appliance placed back in to service and tested by a qualified contractor.

## **WATER HEATER**

There was a 40 gallon capacity, natural gas water heater located in the basement. The water heater was manufactured by Bradford White, Information on the water heater indicated that it was manufactured approximately 8 years ago. A

temperature and pressure relief valve (T & P) was present. Because of the lime build-up typical of T & P valves, we do not test them. An overflow leg was present. It did terminate close to the floor. Your safety depends on the presence of a T & P valve and an overflow leg terminating close to the floor. There was an adequate venting system from the water heater to the exterior of the home. The water heater was on and functional. In cases where the water heater is not on at the time of the inspection, it is not possible for us to verify that hot water is present at all plumbing fixtures, nor can we ensure that mixing hot and cold water to achieve a comfortable water temperature works at the fixtures.

**NOTE: MISSING EXPANSION TANK:**

There is no expansion tank installed on the water heater. Expansion tanks relieve excessive pressure in the plumbing system and help lengthen the life of the water heater. These devices are installed on most newer water heaters. We recommend consulting with a qualified plumber for installation of an expansion tank. Depending on the terms, the lack of an expansion tank could affect any remaining manufacturer's warranty on the water heater.

**NOTE: LEAKY FITTING:**

A leaky plumbing fitting was noted on a cold water supply line above the water heater. Consult with a qualified plumber for repair.



Evidence of seeping leak

## **ELECTRIC SERVICE**

The overhead electric service wire entered the home on the left front wall. The electric meter was located on the exterior wall. The service entrance cable consisted of stranded aluminum rated for 150 amps. The service wire entered a General Electric service panel, located on the basement wall with a 150 amp and 120/240 volt rated capacity. The main service disconnect switch was located in the main panel. The branch circuits within the panel were copper. These branch circuits and the circuit breaker to which they were attached appeared to be appropriately matched. The internal components of the service panel, i.e. main lugs, bus bars, etc were in good condition. The visible house wiring consisted primarily of the Romex type and appeared to be in good condition. An electric service grounding system was installed. Service grounding requirements have changed many times over the years. The grounding system for a 30-year-old electric service is different from that of a 10-year-old service. The inspection does not attempt to verify that the grounding system or any other part of the electric service complies with current codes.

**NOTE: LOOSE WEATHER HEAD:**

The weatherhead at the top of the electric service entrance cable is not attached. Consult with a qualified electrician for repair.



A representative number of installed lighting fixtures, switches, and receptacles located throughout the home were tested. Please note that it is not always possible for us to identify the purpose of every switch in the home. Switches may appear to be inoperable or serve no purpose for a variety of reasons, some of which include switches installed for future use, abandoned switches as part of renovation activities or those that operate a device under special conditions such as the heating of gutters in the winter. Specific questions about the purpose of unidentifiable switch uses should be directed to the current property owner. The grounding and polarity of receptacles within six feet of plumbing fixtures, and those attached to ground fault circuit interrupters (GFCI), if present, were also tested. The installation of GFCI protected circuits and/or outlets located within six feet of water, in unfinished basement areas, garage and the exterior of the home is a commonly accepted practice and required by many municipalities. All GFCI receptacles and GFCI circuit breakers should be tested monthly. There were GFCI protected circuits in the home. The present and tested GFCIs were tested and found to be functional.

**SAFETY NOTE: LOOSE OUTLET:**

A loose outlet was noted in the in the bathroom. This could be a shock hazard due to exposed electrical contacts. The affected outlet(s) should be secured by a qualified contractor.



**NOTE: TWO-PRONG OUTLETS / OPEN- GROUND SYSTEMS:**

Two prong outlets were found in one or more locations in the home. At the time this home was constructed, two-prong outlets were the standard construction. Two-pronged outlets were not grounded (open-ground), and are considered to be outdated by today's standards. In many cases, the outlets can be easily upgraded to three-prong type. In cases where the outlets cannot be easily upgraded, the installation of GFCI's in kitchens, baths, garages, basements, outdoor receptacles, and any other high-risk areas, will increase the overall safety of the electrical system. A qualified electrician should be consulted when working on or updating the electrical system in your home.

The electrical service appeared to be adequate. Alarms, electronic keypads, remote control devices, landscape lighting, telephone and television, and all electric company equipment were beyond the scope of this inspection. An electrical

inspection sticker placed by an independent firm certified to do electrical inspections was not present. Some jurisdictions require an independent electrical inspection and sticker within the last 5 years as a requirement to obtain an occupancy permit. While the requirement to obtain an occupancy permit is usually the sellers, HomeTeam is providing information on the presence of the electrical inspection sticker as a courtesy. There were no material defects observed in the electrical system.

***SAFETY NOTE: MISSING SWITCH OR OUTLET COVERS:***

One or more missing switch or outlet covers were noted in the basement. All switch and outlet boxes should be properly covered to avoid a shock hazard. Electrical related repairs should be performed by a qualified electrician.



## **SMOKE-ALARMS**

There were smoke alarms found in the house. Property maintenance codes vary from area to area. Some municipalities require smoke alarms in every bedroom, while others only require them on each floor. Check with the local code enforcement officer for the requirements in your area. For safety reasons, the smoke alarms should be tested upon occupancy. The batteries (if any) should be replaced with new ones when you move into the house, and tested on a monthly basis thereafter.

## **CARBON MONOXIDE DETECTOR**

HomeTeam recommends installing carbon monoxide detectors in the home. The detector will alert the occupants of the home to the presence of dangerous carbon monoxide caused by a malfunctioning gas appliance. Multi-function devices exist that provide protection for carbon monoxide, smoke and fire. We are not always able to determine if these types of devices are installed. Many carbon monoxide alarms plug into a standard outlet and can easily be removed by the previous owner. You should verify the types of devices installed in your home, replace the batteries and test immediately after closing.

## **WINDOWS, DOORS, WALLS AND CEILINGS**

A representative number of accessible windows and doors were operated and found to be functional. The primary windows were constructed of aluminum and vinyl, double hung and slider style, with insulated glass. We test all operable windows with unobstructed access. We do not comment on the presence or condition of window screens or storm windows. Additionally, windows with access blocked by furniture or personal affects, or those covered with plastic or other stationary interior storm windows are not operated. All exterior doors were operated and found to be functional. The exterior door locks should be changed or rekeyed upon occupancy. Possible problem areas may not be identified if the windows or doors have been recently painted. We do not comment on the presence or condition of storm doors, weather stripping or door insulating materials unless their condition represents a safety concern. There were no material defects observed in the windows or doors.

***NOTE: THERMAL SEALS:***

One or more of the insulated window panes throughout the home had a defective thermal seal. The window (s) were located in the bedroom. A defective thermal seal can be identified when fogging is observed between the panes of glass. This statement should not be considered all inclusive. Our ability to identify defective thermal seals is affected by dirty glass, the angle by which we can view the windows, window coverings and the direction of the sun. It is not

possible to identify mild cases of fogging between glass panes given the conditions that affect our view. Repair of the thermal seal can be accomplished by replacing the affected glass panel.



Left bedroom

The interior wall and ceiling surfaces were finished with drywall and plaster. The interior wall and ceiling structure consisted of wood framing. Possible problem areas may not be identified if the interior wall and ceiling surfaces have been recently painted. Since the finished wall material and framing are different materials, they expand and contract at different rates. As a result, it is common to see cracks on the finished surface especially around door and window openings and ceilings. These cracks are cosmetic and generally have no structural significance. There were no material defects observed in the interior walls or ceilings.

## FIRST LEVEL

The first level consisted of a living room, dining room and kitchen. The HomeTeam inspects for evidence of structural failure and safety concerns only. The cosmetic condition of the paint, wall covering, carpeting, window coverings, etc., are not addressed. There were no material defects observed on the first level.

### *NOTE: CRACKED / BUBBLING PAINT:*

Cracked or bubbling paint was noted on the ceiling in the kitchen. This condition appeared to be caused by water. There was evidence of water damage at the shower walls directly above the area at the time of the inspection. Any damaged areas should be scraped, repaired, leveled and primed prior to applying a finish coat of paint.



An unvented gas fireplace was located in the living room. The unit was visually inspected and did appear to be functional. Many of these units are controlled by a wall mounted switch. Some operate by remote control, while others are controlled from the base of the unit. These units usually come with an instruction plate that is attached to the unit inside the control access panel. Be sure to read and understand the operating procedures prior to operating the unit. There were no material defects observed on the unvented gas fireplace.



The visible portions of the cabinets and counter tops were in fair condition. The appliances were turned on to check operational function only. No consideration is given regarding the age or components that may be worn or otherwise affected by wear and tear or use. No warranty, express or implied, is given for the continued operational integrity of the appliances or their components.

The kitchen contained the following appliances:

The Kenmore natural gas free standing range was inspected and did appear to be functional. The accuracy of the clock, timers and settings on ovens are not within the scope of this inspection. Please note that many new ranges come with an anti-tilt bracket that is supposed to be attached to the wall and to the back of the range. The purpose of the bracket is to ensure that the range does not tilt forward when the oven door is open and racks are pulled out. We do not verify that the bracket is or is not installed at the inspection. Doing so would require us to pull the range away from the wall, risking scratching or other damage to the finished floor. consult with an appliance service for further evaluation if you want to be sure the bracket is installed.

*INFORMATIONAL NOTE: RANGE ANTI TIP BRACKET:*

Newer ranges include an anti-tip bracket designed to provide protection when excess force or weight is applied to an open oven door. The bracket is not visible or readily accessible since it is usually installed beneath a rear foot. Applying excessive force on the oven door can damage the hinge or spring so, we do not confirm the presence of a bracket. HomeTeam recommends that anti-tip brackets be installed on all free-standing ranges.

The Ewave range hood and microwave combination was inspected and did appear to be functional. The exhaust capacity is not within the scope of this inspection. Cleaning the fan and filter may increase the exhaust capability.

The Whirlpool refrigerator was inspected and did appear to be functional. The temperature setting and ice maker, if present, are not within the scope of the inspection.

The Fridgidare dishwasher was tested and did appear to be functional.

The Ewave microwave oven was inspected and did appear to be functional. The accuracy of the clocks, timers and settings are not within the scope of this inspection.

*NOTE: BROKEN APPLIANCE HANDLE:*

The microwave door handle is missing. Consult with an appliance service for repair.

*INFORMATIONAL NOTE: CLOTHES DRYER CONNECTIONS:*

This note is supplied for informational purposes only, as many clients want to know the type of dryer connections available to them. The absence of either type dryer connection is not a problem. A 240 volt outlet for an electric clothes dryer was not installed in the laundry area. If an outlet is present, no attempt was made to verify that the outlet is properly wired or that power is present. A gas connection was available for a gas clothes dryer. For safety reasons, no attempt was made to verify the presence of gas service at the visible gas dryer connection. Consult with a qualified contractor if the desired type of connection is not available.

A dryer vent was installed. The visible portions of the dryer vent was inspected and did appear to be functional. The venting was adequate to vent the dryer to the exterior of the home.

## **SECOND LEVEL**

The second level of the home consisted of two bedrooms and one full bath. There were no material defects observed on the second level.

### *MAINTENANCE NOTE: BATHROOM CAULKING:*

Failure to keep walls sealed can cause deterioration and extensive moisture damage including mold growth to the interior walls, which is not always visible at the time of the inspection. Some of the caulk and grout was missing from around the tub. These areas should be re-caulked and re-grouted to help prevent moisture penetration.



### *NOTE: TUB WALLS:*

The walls in the tub / shower area show evidence of water damage. Concealed water damage may exist behind the finished surface. Determining the existence of concealed damage or defects is beyond the scope of this visual inspection. Consult with a qualified contractor to further evaluate the area and recommend repair methods and provide estimates if applicable.



The second floor stairway was inspected and there were no material defects observed with the steps, stairways or handrails.

## **ATTIC STRUCTURE**

The attic was accessed through a knee-wall in the 2nd floor bedroom. The attic above the living space was insulated with batted insulation, approximately 3 -inches in depth. We do not disturb insulation. As a result any issues concealed by insulation will not be identified.

Ventilation throughout the attic was provided by gable and static vents. The attic ventilation appeared to be questionable. A thermostatically controlled attic fan was not installed. Attic fans are not tested as part of the home inspection.

The roof structure consisted of two-inch by six -inch wood rafters spaced 16 inches on center and wood planks sheathing. The ceiling structure consisted of two-inch by six-inch ceiling joists spaced 16-inches on center.

Because of the configuration of the catwalk or lack thereof, which limited access, it was not possible to inspect all areas of the attic. We will not walk on un-floored areas of the attic.

There was moisture visible in the attic space.

As with all aspects of the home inspection, attic and roof inspections are limited in scope to the visible and readily accessible areas. Many areas of the roof are not visible from the attic especially near the base, where the largest volume of water drains. The presence of or active status of roof leaks cannot be determined unless the conditions which allow leaks to occur are present at the time of the inspection. Please be aware that rain alone is not always a condition that causes a leak to reveal itself. The conditions that cause leaks to occur can often involve wind direction, the length of time it rains, etc. The inspection does not offer or imply an opinion or warranty as to the past, present or future possibility of roof, skylight, flashing or vent leaks. There were no material defects observed in the attic or roof structure.

**NOTE: ATTIC VENTILATION:**


The attic ventilation was questionable. The vents installed could be in conflict with one another. Proper ventilation in the summer helps extend the life of asphalt / fiberglass roofing, as well as reducing radiated heat from the attic to the living space. Proper ventilation in the winter allows heat loss from the living area to exit the home, preventing the possibility of condensation forming in the attic, which could create mold conditions. There was no visual evidence of ventilation related issues in the attic at the time of the inspection. Proper attic ventilation requires creation of natural convection by not just the number of vents installed, but also the location of the vents. It is beyond the scope of the home inspection to determine the adequacy of attic ventilation. Consult with a qualified roofer for further recommendations.

As a future consideration, the addition / upgrade of attic insulation could help control heating and cooling costs. It is common today, for attics to contain up to 16-inches of insulation. The type of insulation including the inclusion of or absence of a vapor retarder, along with proper ventilation are important considerations. Consult with a qualified insulation contractor for recommendations. The addition of insulation should be considered a discretionary improvement rather than a required repair.



**NOTE: ROOF DECK:**

The roof deck as viewed from the attic is water marked. The cause of condition appears to be the result of previous leaks. Repairs to the affected areas are not required. Areas should be monitored during times of heavy rains for any changes or new watermarks.

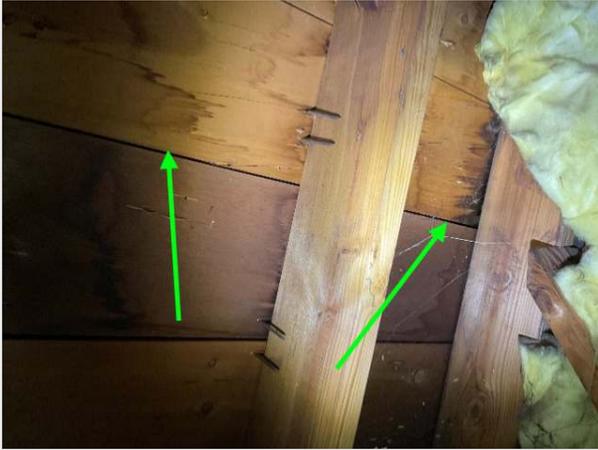

## HEATING SYSTEM

The heating system was inspected by HomeTeam. Annual maintenance of the heating and cooling equipment is essential for safe and efficient performance, which will maximize the system's useful life. The results of our visual and operational inspection of the heating system is described below. Periodic preventive maintenance is recommended to keep this unit in good working condition. The home was heated by a Concord natural gas forced air furnace, which is approximately 6 years old. The unit was located in the basement of the home. It has an approximate net heating capacity of 44,000 BTUH. A carbon monoxide detector with probe was inserted into the main plenum just above the heat exchanger. There was no measurable level of carbon monoxide detected at the time of the inspection.

LIMITATION: Examination of heating systems is mechanically limited since the unit cannot be dismantled to examine all of the interior components. Without removing the burners to gain complete access, and with the limited viewing area of the heat exchanger, a thorough inspection is not possible. The inspection does not include a heat-loss analysis, heating design or adequacy evaluation, energy efficiency assessment, installation compliance check, chimney flue inspection, draft test or buried fuel tank inspection. Termination of HVAC condensate lines was raised above the floor drain or drain inlet. The condensate lines were trapped. HVAC condensate lines must be trapped and not in contact with wet drain inlets to prevent the possible migration of bacteria and mold into the air-handling system. The PVC venting system was adequate to exhaust the spent gases to the exterior of the home and was in good condition. The system was on and the ignition source enabled.. The heating system was functional. The unit appears to have been serviced on a regular basis. The furnace should be serviced annually to maintain safe and efficient operation.

A condensate pump was installed on the HVAC system. A condensate pump drains the water produced by the furnace, air conditioner and humidifier overhead to another location in the home. The condensate pump drained to the drain stack.

## AIR CONDITIONING

The electric outdoor air conditioner condensing unit was an American Standard, The unit is located in the back of the home. This unit is approximately 1 years old. Periodic preventive maintenance is recommended to keep this unit in good working condition. The forced air cooling system was tested and found to be functional. The home inspection does not include a heat-gain analysis, cooling design or adequacy evaluation, energy efficiency assessment, installation

compliance check or refrigerant evaluation.

There will be normal temperature variations from room to room and level to level, most noticeable between levels.

Airflow throughout the house may be balanced by adjusting any dampers in the supply ducts, or by adjusting the supply registers. Inspection of air and duct supply system for adequacy, efficiency, capacity or uniformity of the conditioned air to the various parts of the structure is beyond the scope of the home inspection.

The disposable filter should be replaced on a regular basis to maintain the efficiency of the system. The efficiency rating is not within the scope of this inspection.

## **CONTROLS**

The control for the heating and air conditioning system was a 24 volt thermostat located on the hallway wall of the home. The thermostat was manufactured by Emerson and was found to be in working order.

## **PEST INSPECTION**

The purpose of the pest inspection is to determine if there are active wood destroying insects present in the home. The pest inspection does not include determining the presence of common household insects such as spiders, ants, etc. The pest inspection was performed by Jim Diggins of Quality Pest Services, a state licensed technician. Their completed report was provided at the time of the inspection.

## **RADON TEST**

Radon, the second leading cause of lung cancer, is a radioactive gas that comes from the natural breakdown of uranium in soil and rock and gets into the air you breathe. It moves through the ground and into your home through cracks and other holes in the foundation where it can accumulate to unsafe levels. Because it is odorless, colorless, and tasteless, testing is the only way to know if you and your family are at risk from radon. There are simple ways to fix a problem if needed. (source; Pa Department of Environmental Protection website) The radon test you requested was performed by HomeTeam, a state certified radon testing firm.. An active radon mitigation system was not installed. The radon inspection report will be available as an attachment to your home inspection file upon completion of the test period. HomeTeam uses EPA and Pa DEP compliant continuous radon monitors manufactured by Sun Nuclear. Radon monitor number 8 was used to perform this test. All pertinent information related to the test is included in the official radon report which is an attachment to your file, and is available using the link to your home inspection report provided via email.



### **REASONABLE EXPECTATIONS REGARDING A PROFESSIONAL HOME INSPECTION:**

There may come a time when you discover something wrong with the house, and you may be upset or disappointed with your home inspection. There are some things we'd like you to keep in mind.

**Intermittent or concealed problems:** Some problems can only be discovered by living in a house. They cannot be discovered during the few hours of a home inspection. For example, some shower stalls leak when people are in the shower, but do not leak when you simply turn on the tap. Some roofs and basements only leak when specific conditions exist. Some problems will only be discovered when carpets are lifted, furniture is moved or finishes are removed.

**No clues:** These problems may have existed at the time of the inspection, but there were no clues as to their existence. Our inspections are based on the past performance of the house. If there are no clues of a past problem, it is unfair to assume we should foresee a future problem.

**We always miss some minor things:** Some say we are inconsistent because our reports identify some minor problems but not others. The minor problems that are identified were discovered while looking for more significant problems. We note them simply as a courtesy. The intent of the inspection is not to find the \$200 problems; it is to find the \$1000 problems. These are the things that affect people's decisions to purchase.

**Contractor's advice:** A common source of dissatisfaction with home inspectors comes from comments made by contractors. Contractors' opinions often differ from ours. Don't be surprised when three roofers all say the roof needs replacement, when we said that the roof would last a few more years with some minor repairs.

**"Last man in" theory:** While our advice represents the most prudent thing to do, many contractors are reluctant to undertake these repairs. This is because of the "last man in" theory. The contractor fears that if he is the last person to work on the roof, he will get blamed if the roof leaks, regardless of whether or not the roof leak is his fault. Consequently, he won't want to do a minor repair with high liability, when he could re-roof the entire house for more money and reduce the likelihood of a callback. This is understandable.

**Most recent advice is best:** There is more to the "last man in" theory. It suggests that it is human nature for homeowners to believe the last bit of expert advice they receive, even if it is contrary to previous advice. As home inspectors, we unfortunately find ourselves in the position of "first man in" and consequently it is our advice that is often disbelieved.

**Why didn't we see it?:** Contractors may say, "I can't believe you had this house inspected, and they didn't find this problem." There are several reasons for these apparent oversights:

- **Conditions during inspection:** It is difficult for homeowners to remember the circumstances in the house at the time of the inspection. Homeowners seldom remember that it was snowing, there was storage everywhere or that the furnace could not be turned on because the air conditioning was operating, etc. It's impossible for contractors to know what the circumstances were when the inspection was performed.
- **This wisdom of hindsight:** When the problem manifests itself, it is very easy to have 20/20 hindsight. Anybody can say that the basement is wet when there is 2" of water on the floor. Predicting the problem is a different story.
- **A long look;** If we spent half an hour under the kitchen sink or 45 minutes disassembling the furnace, we'd find more problems, too. Unfortunately, the inspection would take several days and would cost considerably more.
- **We're generalists:** We are generalists; we are not specialists. The heating contractor may indeed have more heating expertise than we do. This is because we are expected to have heating expertise and plumbing expertise, structural expertise, electrical expertise, etc.
- **An invasive look:** Problems often become apparent when carpets or plaster are removed, when fixtures or cabinets are pulled out, and so on. A home inspection is a visual examination. We don't perform invasive or destructive tests.

**Not insurance:** In conclusion, a home inspection is designed to better your odds. It is not designed to eliminate all risk. For that reason, a home inspection should not be considered an insurance policy. The premium that an insurance company would have to charge for a policy with no deductible, no limit and an indefinite policy period would be considerably more than the fee we charge. It would also not include the value added by the inspection.

*Reprinted from ASHI Reporter, By Permission of Alan Carson, Carson Dunlop & Assoc.*