Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection Date: Aug 1, 2022		
Owner Information		
Owner Name: RICHARD MILLER		Contact Person:
Address: 2061 BIG PASS LN. PUNTA GORDA, FL. 33955		Home Phone:
City: PUNTA GORDA	Zip: 33955	Work Phone:
County: LEE		Cell Phone:
Insurance Company:		Policy #:
Year of Home: 1994	# of Stories: 1	Email:

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 though 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form.

1. **Building Code**: Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?

   ☐ A. Built in compliance with the FBC: Year Built _____. For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY) ____/____/_____

   ☐ B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) ___/___/_____

   ☑ C. Unknown or does not meet the requirements of Answer "A" or "B"

2. **Roof Covering:** Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

2.1 Roof Covering Type:	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
☐ 1. Asphalt/Fiberglass Shingle	___/___/_____			☐
☑ 2. Concrete/Clay Tile	03-21-22		2022	☐
☐ 3. Metal	___/___/_____			☐
☐ 4. Built Up	___/___/_____			☐
☐ 5. Membrane	___/___/_____			☐
☐ 6. Other_____	___/___/_____			☐

   ☑ A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.

   ☐ B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.

   ☐ C. One or more roof coverings do not meet the requirements of Answer "A" or "B".

   ☐ D. No roof coverings meet the requirements of Answer "A" or "B".

3. **Roof Deck Attachment**: What is the **weakest** form of roof deck attachment?

   ☐ A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shakes or wood shingles. -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.

   ☐ B. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field.-OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance than 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.

   ☑ C. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR-

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.**

Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

- ☐ D. Reinforced Concrete Roof Deck.
- ☐ E. Other: _____
- ☐ F. Unknown or unidentified.
- ☐ G. No attic access.

4. **Roof to Wall Attachment:** What is the **WEAKEST** roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)

- ☐ A. Toe Nails
  - ☐ Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or
  - ☐ Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

- ☑ Secured to truss/rafter with a minimum of three (3) nails, **and**
- ☑ Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a ½" gap from the blocking or truss/rafter **and** blocked no more than 1.5" of the truss/rafter, **and** free of visible severe corrosion.

- ☐ B. Clips
  - ☐ Metal connectors that do not wrap over the top of the truss/rafter, **or**
  - ☐ Metal connectors with a minimum of 1 strap that wraps over the top of the truss/rafter and does not meet the nail position requirements of C or D, but is secured with a minimum of 3 nails.
- ☑ C. Single Wraps
  Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.
- ☐ D. Double Wraps
  - ☐ Metal Connectors consisting of 2 separate straps that are attached to the wall frame, or embedded in the bond beam, on either side of the truss/rafter where each strap wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side, and a minimum of 1 nail on the opposing side, **or**
  - ☐ Metal connectors consisting of a single strap that wraps over the top of the truss/rafter, is secured to the wall on both sides, and is secured to the top plate with a minimum of three nails on each side.
- ☐ E. Structural Anchor bolts structurally connected or reinforced concrete roof.
- ☐ F. Other: _____
- ☐ G. Unknown or unidentified
- ☐ H. No attic access

5. Roof Geometry: What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).

- ☑ A. Hip Roof — Hip roof with no other roof shapes greater than 10% of the total roof system perimeter.
  Total length of non-hip features: -0- feet; Total roof system perimeter: 222 feet
- ☐ B. Flat Roof — Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12 _____ sq ft; Total roof area _____sq ft
- ☐ C. Other Roof — Any roof that does not qualify as either (A) or (B) above.

6. **Secondary Water Resistance (SWR):** (standard underlayments or hot-mopped felts do not qualify as an SWR)

- ☑ A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.
- ☐ B. No SWR.
- ☐ C. Unknown or undetermined.

Inspectors Initials KSL **Property Address** 2061 BIG PASS LN. PUNTA GORDA, FL. 33955

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.**

7. **Opening Protection:** What is the **weakest** form of wind borne debris protection installed on the structure? **First**, use the table to determine the weakest form of protection for each category of opening. **Second**, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings **and** (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Opening Protection Level Chart **Place an "X" in each row to identify all forms of protection in use for each opening type. Check only one answer below (A thru X), based on the weakest form of protection (lowest row) for any of the Glazed openings and indicate the weakest form of protection (lowest row) for Non-Glazed openings.**		Glazed Openings				Non-Glazed Openings	
		Windows or Entry Doors	Garage Doors	Skylights	Glass Block	Entry Doors	Garage Doors
N/A	Not Applicable- there are no openings of this type on the structure	☐	☐	✓	☐	✓	✓
A	Verified cyclic pressure & large missile (9-lb for windows doors/4.5 lb for skylights)	✓	☐	☐	✓	☐	☐
B	Verified cyclic pressure & large missile (4-8 lb for windows doors/2 lb for skylights)	☐	☐	☐	☐	☐	☐
C	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007	☐	☐	☐	☐	☐	☐
D	Verified Non-Glazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI/DASMA 108, or PA/TAS 202 for wind pressure resistance					☐	☐
N	Opening Protection products that appear to be A or B but are not verified	☐	☐	☐	☐	☐	☐
	Other protective coverings that cannot be identified as A, B, or C	☐	☐	☐	☐	☐	☐
X	No Windborne Debris Protection	☐	✓	☐	☐	☐	☐

☐ **A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only)** All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).

Miami-Dade County PA 201, 202, **and** 203

Florida Building Code Testing Application Standard (TAS) 201, 202, **and** 203

American Society for Testing and Materials (ASTM) E 1886 **and** ASTM E 1996

Southern Standards Technical Document (SSTD) 12

For Skylights Only: ASTM E 1886 **and** ASTM E 1996

For Garage Doors Only: ANSI/DASMA 115

☐ A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist

☐ A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above

☐ A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above

☐ **B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only)** All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):

ASTM E 1886 **and** ASTM E 1996 (Large Missile – 4.5 lb.)

SSTD 12 (Large Missile – 4 lb. to 8 lb.)

For Skylights Only: ASTM E 1886 **and** ASTM E 1996 (Large Missile - 2 to 4.5 lb.)

☐ B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist

☐ B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above

☐ B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above

☐ **C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007** All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).

☐ C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist

☐ C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above

☐ C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspectors Initials KSL **Property Address** 2061 BIG PASS LN. PUNTA GORDA, FL. 33955

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.**

☐ **N. Exterior Opening Protection (unverified shutter systems with no documentation)** All Glazed openings are protected with protective coverings not meeting the requirements of Answer "A", "B", or C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).

☐ N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist

☐ N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above

☐ N.3 One or More Non-Glazed openings is classified as Level X in the table above

☒ **X. None or Some Glazed Openings** One or more Glazed openings classified and Level X in the table above.

MITIGATION INSPECTIONS MUST BE CERTIFIED BY A QUALIFIED INSPECTOR.
Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.

Qualified Inspector Name:	License Type:	License or Certificate #:
KENNETH SCOTT LAWRENCE	RESIDENTIAL CONTRACTOR	CRC1329147
Inspection Company:		**Phone:**
VERSIFI HOMES INC.		239-333-7723

Qualified Inspector – I hold an active license as a: (check one)

☐ Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam.

☐ Building code inspector certified under Section 468.607, Florida Statutes.

☑ General, building or residential contractor licensed under Section 489.111, Florida Statutes.

☐ Professional engineer licensed under Section 471.015, Florida Statutes.

☐ Professional architect licensed under Section 481.213, Florida Statutes.

☐ Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statues, must inspect the structures personally and not through employees or other persons. Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

I, Kenneth Scott Lawrence **(print name) am a qualified inspector and I personally performed the inspection or (*licensed contractors and professional engineers only*) I had my employee (** N/A **(print name of inspector)) perform the inspection and I agree to be responsible for his/her work.**

Qualified Inspector Signature: _____ **Date:** Jul 25, 2022

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.

Signature: _____ **Date:** Jul 25, 2022

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)

The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspectors Initials KSL **Property Address** 2061 BIG PASS LN. PUNTA GORDA, FL. 33955

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.**



Image Field

FE-1 OPENING WITH IMPACT RATED ROLL UP SHUTTER



Image Field

FE-2 ADDRESS VALIDATION

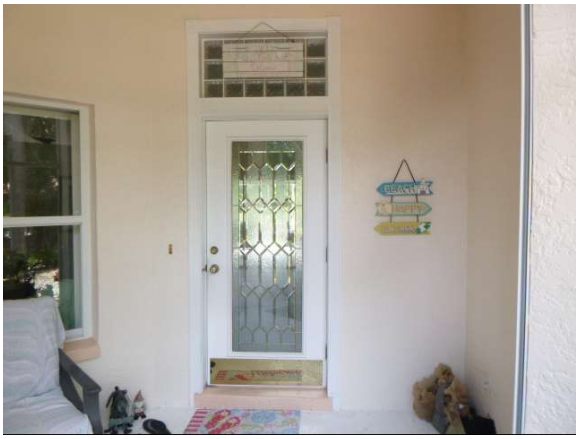


Image Field

FE-3 GLAZED DOOR WITH IMPACT RATED ROLL UP SH.



Image Field

FE-4 OPENING WITH IMPACT RATED ROLL UP SHUTTER



Image Field

FE-5 GLAZED GARAGE DOOR WITH NO PROTECTION



Image Field

RE-1 GLASS BLOCK WITH IMPACT RATED PANEL SHUTTERS

New Page



Image Field

BE-1 WINDOWS WITH IMPACT RATED ACCORDION SH.



Image Field

BE-2 OPENING WITH IMPACT RATED ROLL UP SHUTTER



Image Field

BE-3 GLAZED DOORS WITH IMPACT RATED ACCORDION SH.



Image Field

BE-4 WINDOWS WITH IMPACT RATED ACCORDION SH.



Image Field

LE-1 WINDOWS WITH IMPACT RATED ACCORDION SH.



Image Field

LE-2 WINDOW WITH IMPACT RATED ACCORDION SH.

New Page



Image Field

A-1 FRONT STRAP WITH 2 NAILS



Image Field

A-2 BACK OF STRAP WITH 2 NAILS



Image Field

A-3 FRONT STRAP WITH 2 NAILS



Image Field

A-4 BACK OF STRAP WITH 2 NAILS



Image Field

A-5 8D NAIL ROOF DECK ATTACHMENT



Image Field

A-6 1/2" ROOF DECKING

New Page



Image Field

A-7 6" SPACING OF FASTENERS IN FIELD OF DECKING



Image Field

A-8 SWR PHOTO IN ATTIC



Image Field

IMPACT RATED PANEL SHUTTERS

Image Field

Image Field

New Page

Property Data

STRAP: 06-43-23-17-00000.0130 Folio ID: 10025674

Generated on 7/22/2022 4:38 PM

Owner Of Record - Tenants by Entirety [Change Address]

MILLER RICHARD D & PEGGY L
2061 BIG PASS LN
PUNTA GORDA FL 33955

Site Address

Site Address maintained by E911 Program Addressing

2061 BIG PASS LN
PUNTA GORDA FL 33955

Property Description

Do not use for legal documents!

TARPON PASS II PH II
LAND CONDO OR 2533 PG 3190
LOT 13

[Tax Map Viewer] [View Comparables]



[Pictometry Aerial Viewer]

Current Working Values

Just	324,823

Attributes

Land Units Of Measure	LT
Units	1.00
Total Number of Buildings	1
Total Bedrooms / Bathrooms	2 / 2.0
Gross Living Area	1,651
1st Year Building on Tax Roll	1994
Historic Designation	No

Image of Structure



Photo Date April of 2013 View other photos

Last Inspection Date: 02/19/2018

Exemptions

Generated on 7/22/2022 4:38 PM

Values (2021 Tax Roll)

Generated on 7/22/2022 4:38 PM

Taxing Authorities

Generated on 7/22/2022 4:38 PM

Sales / Transactions

Generated on 7/22/2022 4:38 PM

Building/Construction Permit Data

Generated on 7/22/2022 4:38 PM

Permit Number	Permit Type	Date
ROF2022-02179	Roof	03/21/2022
199409522	Residential	10/10/1994

IMPORTANT: THIS MAY NOT BE A COMPREHENSIVE OR TIMELY LISTING OF PERMITS ISSUED FOR THIS PROPERTY.

Note: The Lee County Property Appraiser's Office does not issue or maintain any permit information. The Building/Construction permit data displayed here represents only those records this Office may find necessary to conduct Property Appraiser business. Use of this information is with the understanding that in no way is this to be considered a comprehensive listing of permits for this or any other parcel.

The Date field represents the date the property appraiser received information regarding permit activity; it may or not represent the actual date of permit issuance or completion.

Full, accurate, active and valid permit information for parcels can only be obtained from the appropriate permit issuing agency.

Parcel Numbering History

Generated on 7/22/2022 4:38 PM

Location Information

Generated on 7/22/2022 4:38 PM

Solid Waste (Garbage) Roll Data

Generated on 7/22/2022 4:38 PM

Flood and Storm Information

Generated on 7/22/2022 4:38 PM

Address History

Generated on 7/22/2022 4:38 PM

Appraisal Details (2021 Tax Roll)

Generated on 7/22/2022 4:38 PM

Appraisal Details (Current Working Values)

Generated on 7/22/2022 4:38 PM

Land

Land Tracts

Use Code	Use Code Description	Number of Units	Unit of Measure
400	Land Condo	1.00	Lot

Land Features

Description	Year Added	Units
IRRIGATION SYSTEM LAWN	1994	1

Buildings

Building 1 of 1

Building Characteristics

Improvement Type	Model Type	Stories	Living Units
102 - Ranch	1 - single family residential	1.0	1

Bedrooms	Bathrooms	Year Built	Effective Year Built

2	2.0	1994	1994

Building Subareas

Description	Heated / Under Air	Area (Sq Ft)
BAS - BASE	Y	1,651
FGR - FINISHED GARAGE	N	470
FOP - FINISHED OPEN PORCH	N	155
FSP - FINISHED SCREEN PORCH	N	111
PS1 - 1 STORY SCREEN ENCL	N	412

Building Features

Description	Year Added	Units
PATIO - CONCRETE	1994	418

Building Front Photo



Photo Date: April of 2013

Building Footprint

